



# Georgia Department of Agriculture Fuel and Measures

19 MLK Room 321 Atlanta, Georgia 30334-4201  
Phone 404-656-3605 Fax 404-656-9648

## Device Inspection Test Grid Summary

**Insp Date:** 5/2/2018      **Business ID:** 27437  
**Business:** GAS AND FOOD MARKET  
 600 W HOWARD AVE  
 DECATUR, GA 300302959

**Inspection:** 22003976  
**Store ID:**  
**Phone:** 404.377.5405  
**Inspector:** 22-F Rasheed Largie  
**Reason:** Complaint

Class	Insp	APP	OT+	OT-	NC	DLK	P/E	ADD	V	OTS	Rej
Liquid Measuring Device	2	2									
Pump Business	1								1		
UGT	2	2									

Make	Model	Serial #		Location	Other	Failed Attribs	Test	Error	Results	Prod Used	Notes
Tokheim	New	0901 126-106576A	Regular	2			Normal Flow	1	Approved	5.400	
Tokheim	New	0901 126-106576A	Premium	2			Normal Flow	2	Approved	5.410	
Tank	Regular	27437					Tanks Stuck for W Water/Trash Violati	0	Approved	0.000	
Tank	Premium	27437					Tanks Stuck for W Water/Trash Violati	0	Approved	0.000	
Station	N/A	27437				Station Registration	Advertising Violatio Other Violations	0	Violation	0.000	

**Device Product Used:** 10.81    **Insp Product Used:** .    **Tot Product Used:** 10.81

Grade	Prod Used
Premium	5.41
Regular	5.40

*[Handwritten Signature]*

Inspector

*[Handwritten Signature]*

Acknowledged Receipt : JENEES PATEL


## Device Inspection Test Grid Summary

Billing Address:

Notes:

NO WATER FOUND IN REGULAR AND PREMIUM UNDERGROUND TANKS. STATION WAS ALLOWED TO SALE PREMIUM GAS BECAUSE STATION PASSED VISUAL INSPECTION. INFORMED STATION THAT IF LAB SAMPLE FAILS INSPECTION A STOP SALE WILL BE ISSUED. PUMP REGISTRATION WAS NOT VISIBLE IN STORE AND VIOLATION WAS GIVEN.

Inspection results do not meet State of Georgia specifications.

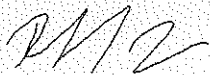

Inspector



Acknowledged Receipt : JENEES PATEL





**GEORGIA DEPARTMENT OF AGRICULTURE**

Gary W. Black, Commissioner

www.agr.georgia.gov

State Fuel Oil Laboratory ● 3150 U.S. Highway 41 South ● Tifton, Georgia 31794  
FAX 229 386-3369 ● Phone 229 386-3486 ● Email David.Au@agr.georgia.gov

David Au  
Director

**REPORT OF ANALYSIS**

GAS AND FOOD MART  
600 W. HOWARD AVE.  
DECATUR, GA 30030

Please find attached lab analysis for sample(s) collected from subject facility. These are additionally identified below.

If you have any questions regarding these results, feel free to contact the lab.

STATE OIL CHEMIST

**REMARKS:**

PRODUCT #002 MEETS ASTM SPECIFICATIONS ON TESTS PERFORMED. HOWEVER PRODUCT #003 CONTAINS WATER.

**SAMPLE IDENTIFICATION**

SAMPLE DATE	SEQ. #	BATCH	UNIT	PRODUCT	COLLECTION DATE	PUMP/ TANK #
05/07/2018	002	27437	122	REGULAR 87	05/02/2018	PUMP # 2
05/07/2018	003	27437	122	PREMIUM 93	05/02/2018	PUMP # 2

**COMPLAINT INSPECTION AREA****122**

<b>SAMPLE</b>	<b>PREMIUM 93</b>
<b>DATE</b>	<b>5/7/2018</b>
<b>SEQ #</b>	<b>003</b>
<b>BOTTLE #</b>	<b>52, 3411</b>
<b>FACILITY CODE</b>	<b>27437</b>
<b>BRAND CODE</b>	<b>099</b>
<b>PRODUCT CODE</b>	<b>052</b>
<b>SUPPLIER</b>	<b>CITGO</b>
<b>CARRIER</b>	<b>KENAN</b>
<b>TERMINAL</b>	<b>CITGO</b>
<b>AKI</b>	<b>93</b>
<b>INITIAL BP</b>	<b>89</b>
<b>10%</b>	<b>116</b>
<b>50%</b>	<b>214</b>
<b>90%</b>	<b>319</b>
<b>ENDPOINT:</b>	<b>376</b>
<b>% RESIDUE:</b>	<b>1.0</b>
<b>% LOSS:</b>	<b>2.5</b>
<b>PRON</b>	<b>96.9</b>
<b>PMON</b>	<b>87.6</b>
<b>PON</b>	<b>92.3</b>
<b>RVP</b>	<b>10.31</b>
<b>V/L</b>	<b>124.6</b>
<b>ETHANOL, %</b>	<b>5.6</b>
<b>DRIVEABILITY INDEX</b>	<b>1107</b>
<b>BOTTOM SEDIMENT</b>	<b>PASS</b>
<b>WATER</b>	<b>FAIL</b>
<b>RESULTS</b>	<b>FAIL - CONTAINS WATER</b>

**COMPLAINT INSPECTION AREA**

122

<b>SAMPLE</b>	<b>REGULAR 87</b>
<b>DATE</b>	<b>5/7/2018</b>
<b>SEQ #</b>	<b>002</b>
<b>BOTTLE #</b>	<b>411, A155</b>
<b>FACILITY CODE</b>	<b>27437</b>
<b>BRAND CODE</b>	<b>099</b>
<b>PRODUCT CODE</b>	<b>050</b>
<b>SUPPLIER</b>	<b>CITGO</b>
<b>CARRIER</b>	<b>KENAN</b>
<b>TERMINAL</b>	<b>CITGO</b>
<b>AKI</b>	<b>87</b>
<b>INITIAL BP</b>	<b>87</b>
<b>10%</b>	<b>119</b>
<b>50%</b>	<b>155</b>
<b>90%</b>	<b>326</b>
<b>ENDPOINT:</b>	<b>394</b>
<b>% RESIDUE:</b>	<b>1.1</b>
<b>% LOSS:</b>	<b>1.9</b>
<b>PRON</b>	<b>92.8</b>
<b>PMON</b>	<b>84.4</b>
<b>PON</b>	<b>88.6</b>
<b>RVP</b>	<b>10.06</b>
<b>V/L</b>	<b>123.4</b>
<b>ETHANOL, %</b>	<b>9.3</b>
<b>DRIVEABILITY INDEX</b>	<b>963</b>
<b>BOTTOM SEDIMENT</b>	<b>PASS</b>
<b>WATER</b>	<b>PASS</b>
<b>RESULTS</b>	<b>PASS</b>